


Flow Chart

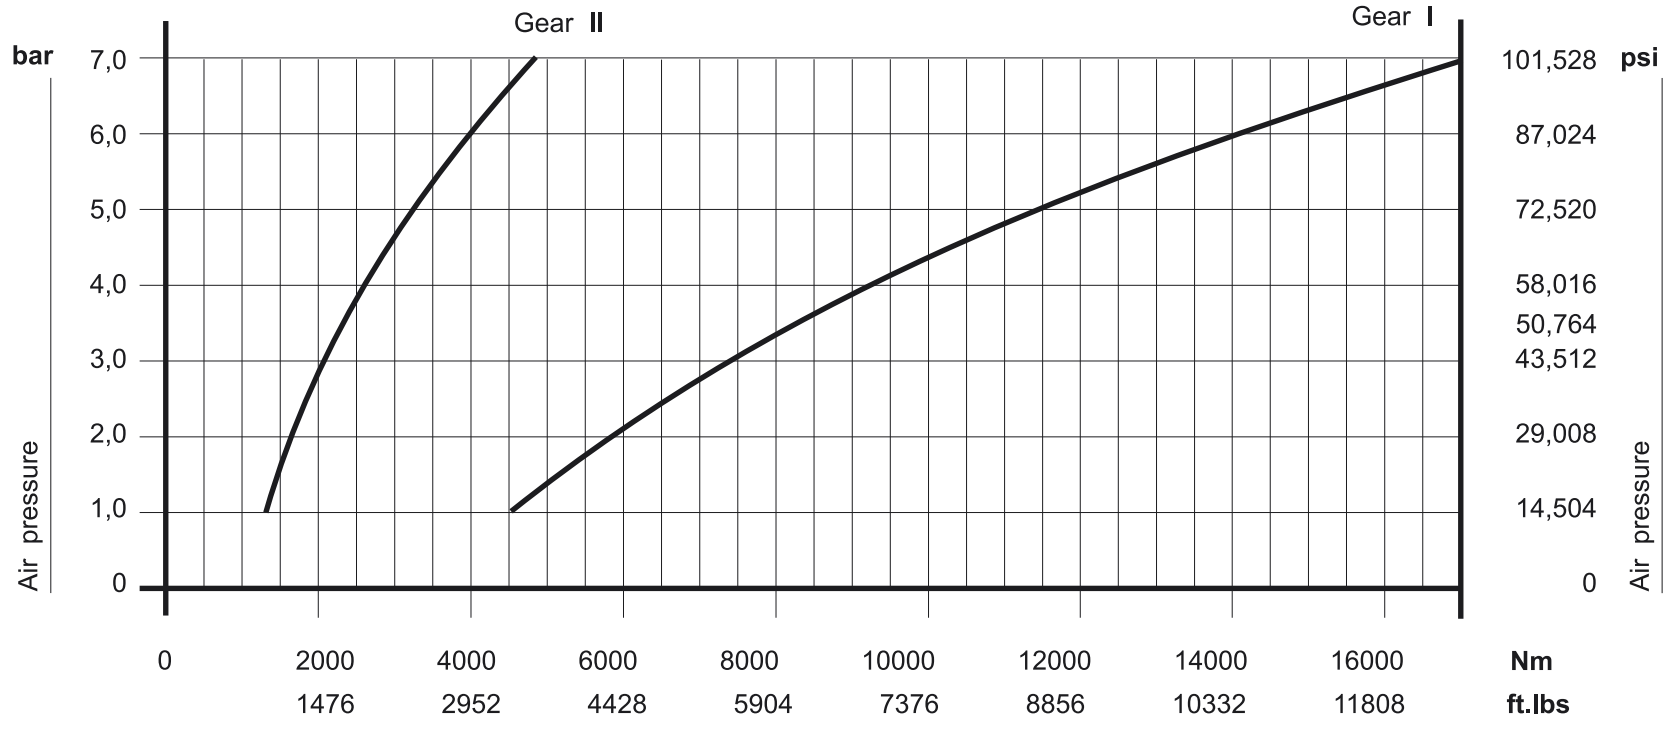

Torque table		
Gear II bar	Nm max	ft.lbs max
2	1655	1220
3	2090	1543
4	2645	1952
5	3240	2390
6	3970	2928
7	4860	3585

Gear I bar	Nm max	ft.lbs max
2	5790	4269
3	7320	5400
4	9260	6831
5	11340	8366
6	13890	10246
7	17015	12549

Operating pressure on the machine
Air Consumption:
 21 - 32 cfm.

Torque

All curves are approximate values. Unstable compressed air values can cause deviations.

TECHNICAL DATA

AIR-Tite

AT 12500F-2

Model

45-7-

Equipment Serial Number

Date of Delivery



TITAN
 TECHNOLOGIES INTERNATIONAL, INC.

SUPERIOR BOLTING SOLUTIONS

www.TitanTi.com